




## TRAILER AIR SUSPENSIONS

## TECHNICAL BULLETIN

This document replaces  
Trailer AUS 055 and 49441-102

No: 97117-102  
Subject: *HT Top Plate Update*

Date: July 1996      Revision: B

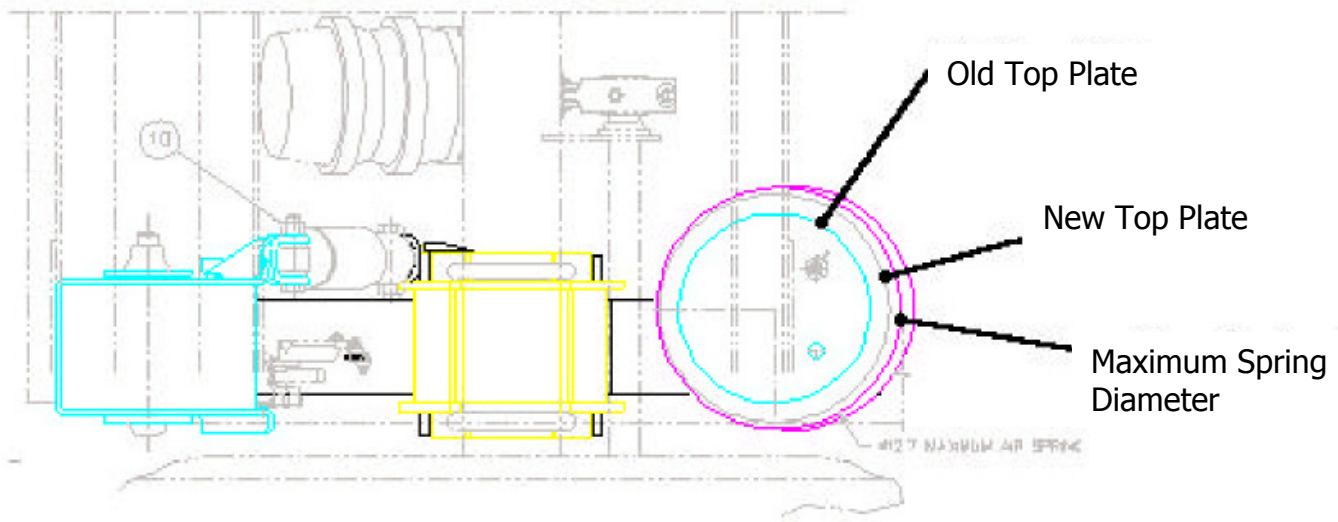

### **Description**

As part of our continuous product improvement program, Hendrickson has increased the diameter of the upper air spring plate on our HT250U-7.5-517 trailer air suspension.

This improvement is intended to improve air spring durability by providing a larger surface for the compressed air spring to contact.

The upper air spring plate has increased from 10" (244mm) to 12" (300mm).

Hendrickson specifies in installation drawings that the trailer design must allow a clearance of 12.6" (320mm) in diameter for the expansion of the air spring.

Consequently clearance changes should not be necessary for the improved top plate.

This detail is included in the current installation drawing for the suspension.

Production staff however should be made aware of the change to allow for any tooling adjustments which may be required.

If further assistance is required, contact the Hendrickson Product Support Department or a member of our Repairer Network on 1300 130 960